

TECHNICAL SERVICE BULLETIN

73-C-2

NO.



Austin MG

May, 1973

SUBJECT:

MARINA WATER LEAKS

MODELS:

AUSTIN MARINA

A number of complaints have been received of water dripping onto the parcel shelf of the Marina, just below the hood release knob and in a similar position on the driver's side. The point of entry has been traced to the windshield glazing rubber.

Sealing this rubber between the body and the rubber itself with CONCORD PLEXO Windshield Bedding Calk #1162 will affect a cure when applied to the area across the top and down each side, paying particular attention to each corner.

Another point of water entry is via the windshield wiper arm ferrule rubber seals. Usually, this can be cured by simply tightening the securing nuts.

J.P.