

TECHNICAL SERVICE BULLETIN

NO. 74-C-1



Austin MG

June, 1974

SUBJECT:

WATER LEAKS

MODELS:

AUSTIN MARINA

If water is found in the front footwell of the Austin Marina, it may be due to the tape patches coming adrift from the door panel apertures (see diagram). We would remind you that the windscreen should also be checked for leaks, in accordance with Technical Service Bulletin #73-C-2.

Suitable waterproof tape, 4-1/2 in. wide, which is not affected by extreme temperature changes is generally available from local jobbers and is best suited for this application.

Size of patches required:

- A = 6" x 6"
- B = 13-1/2" x 6"
- C = 2" x 1-1/2"
- D = 3-1/2" x 3"
- E = 7" x 3"
- F = 1" x 1"
- G = 7" x 5-1/2"
- H = 6" x 5-1/2"
- J = 7" x 5-1/2"
- K = 7-1/2" x 5"
- L = 14" x 2"

AM/PB/12C

