



Austin MG

February, 1975

SUBJECT:

DIRECTION INDICATOR/WINDSCREEN WIPER
SWITCHES

MODELS:


MARINA

Switches of alternative manufacture are now being fitted to these vehicles.

Whilst the individual wiper or direction indicator switches of the original assembly, Fig. 1, are serviced separately, this is not the case as far as the alternative switch, Fig. 2, is concerned.

Should it be necessary to replace a switch of the latter category, this can only be done by obtaining the two individual switches included in the assembly shown in Fig. 1.

Please note the switch, Fig. 1, is dismantled by removing the two rivets 'A' and reassembled using the two screws supplied with the replacement switches.

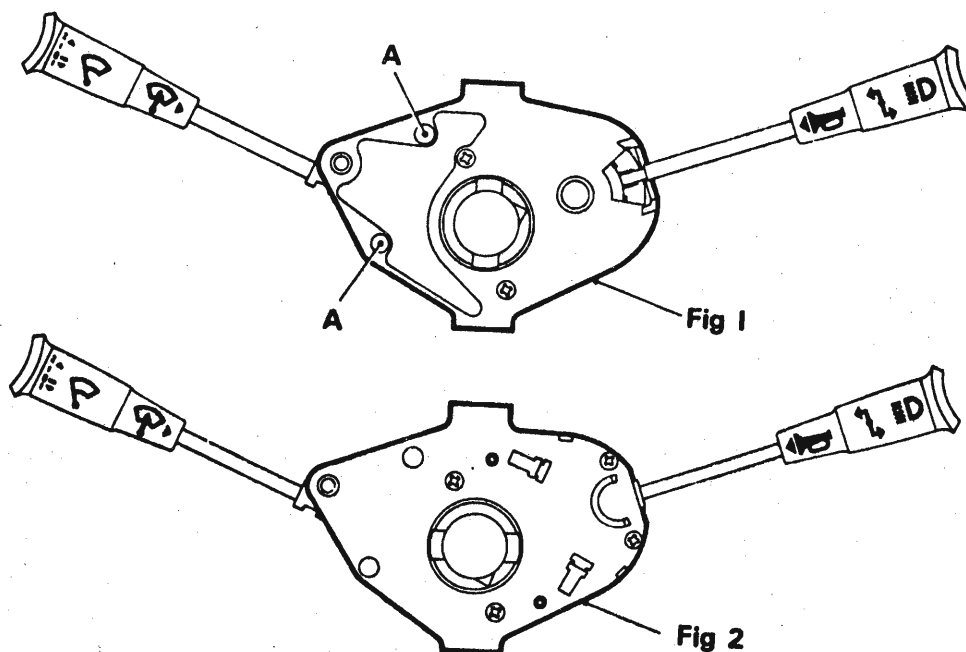

1973 - Direction Indicator - Lucas Part No. 39742
" - Windscreen Wiper - Lucas Part No. 39743

1974 - Direction Indicator - Lucas Part No. 39818
" - Windscreen Wiper - Lucas Part No. 39819